


Model 5068 Stress Relief Boot W/BNC Male Connector RG 174, 187 & 188

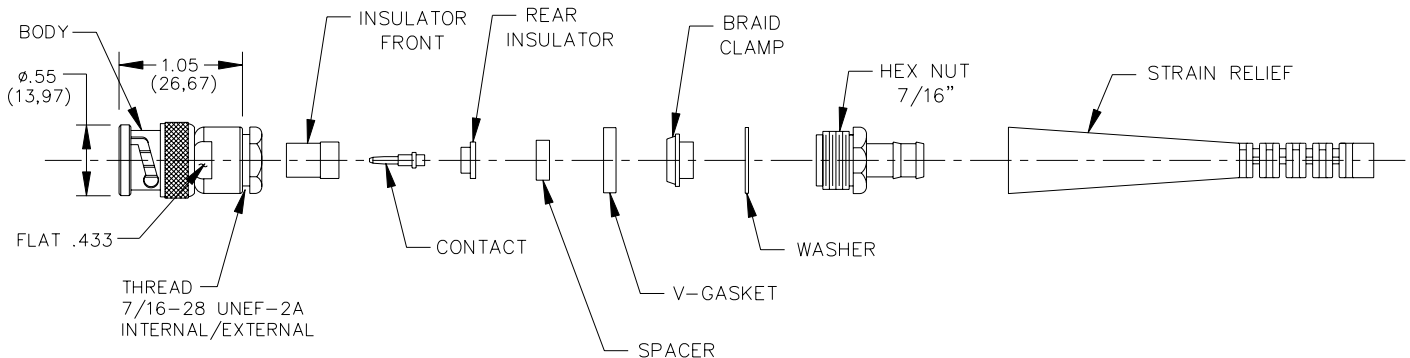

MATERIALS:

BNC Male

Body and Fittings – Brass per QQ-B-626, Alloy 360, ½ Hard.

Center Contact – Brass per QQ-B-626, Alloy 360, ½ Hard.

Dielectric (Front Insulator and Rear Insulator) – Teflon per ASTM D1457.

Vee Gasket – Silicone rubber per QQ-R-765, Class 11A, Grade 50.

Clamp Nut, Washer and Spacer – Brass per QQ-B-626, Alloy 360, ½ Hard.

Finish:

Body and Fittings – Tarnish resistant

Center Contact – Gold plated per requirements of MIL-C-39012

Clamp Nut – Nickel-plated per QQ-N-290, Class 2, 200/300 micro inches.

Stress Relief Boot

Boot – PVC. Marking: “POMONA ELECTRONICS”

RATINGS:

Operating Temperature: +50°C. (+122°F.) Max.

Operating Voltage: 500 VRMS

ORDERING INFORMATION: Model 5068-*

*= Color, Standard Colors: -0 Black, additional colors can be quoted upon request.

All dimensions are in inches. Tolerances (except noted): .xx = ±.02” (.51 mm), .xxx = ±.005” (.127 mm).

All specifications are to the latest revisions. Specifications are subject to change without notice.

Registered trademarks are the property of their respective companies.

Sales: 800-490-2361 Fax: 888-403-3360 Technical Support: 800-241-2060 (technicalsupport@pomonatest.com)
For “Where to Buy” information, visit the Pomona web site at www.pomonaelectronics.com

Model 5068 Stress Relief Boot W/BNC Male Connector RG 174, 187 & 188

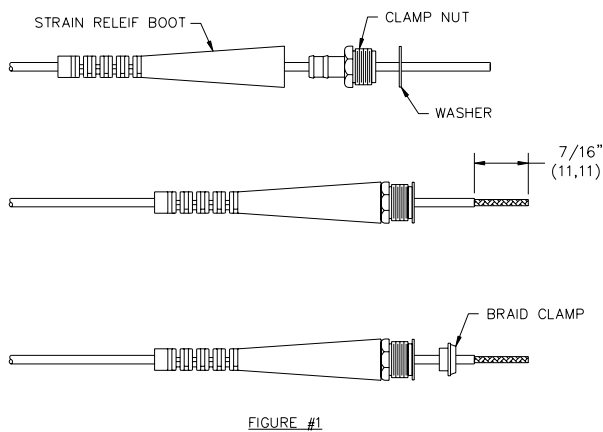


FIGURE #1

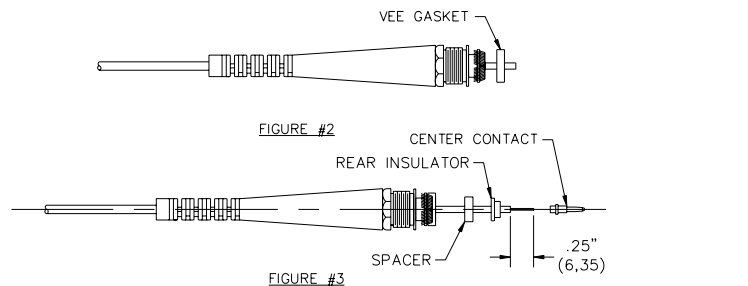


FIGURE #2

FIGURE #3




FIGURE #4

FIGURE #1

- A. Slide strain relief, clamp nut and washer over cable.
- B. Trim outer jacket from cable.
- C. Slide center conductor, dielectric and braid through braid clamp.

FIGURE #2

- D. Fold back braid back over braid clamp and trim braid.
- E. Slide V-Gasket over center conductor and dielectric on top of braid clamp.

FIGURE #3

- F. Slide spacer and rear insulator over center conductor and dielectric.
- G. Strip dielectric from center conductor.
- H. Slide contact onto center conductor and solder.

FIGURE #4

- I. Place front insulator into connector body.
- J. Assemble connector body.

All dimensions are in inches. Tolerances (except noted): .xx = $\pm .02$ " (.51 mm), .xxx = $\pm .005$ " (.127 mm).
All specifications are to the latest revisions. Specifications are subject to change without notice.
Registered trademarks are the property of their respective companies.

Sales: 800-490-2361 Fax: 888-403-3360 Technical Support: 800-241-2060 (technicalsupport@pomonatest.com)
For "Where to Buy" information, visit the Pomona web site at www.pomonaelectronics.com