Messtechnik GmbH Weidenweg 21 58239 Schwerte

PEWA

Tel.: 02304-96109-0 Fax: 02304-96109-88 E-Mail: info@pewa.de Homepage: www.pewa.de

Model 73011 MCX JACK STRAIGHT CRIMP, RG178



Model 73011 MCX JACK STRAIGHT CRIMP, RG178

Snap-on coupling and miniature size for fast connect and disconnect where space is limited.

Features

- DC 3 GHz bandwidth.
- 30% smaller than SMB connectors.
- Meets CECC 22220.
- Perfect for applications where space, weight, performance and ease of assembly are required.
- Precision machined and gold-plated for low loss.

Materials

- Body is machined brass with gold plating.
- Center contacts Plug is gold plated brass and Jack is gold plated beryllium copper.
- High quality PTFE insulators.
- Crimp Ferrules are gold or nickel plated copper.

Ordering Information

Model: 73011

Description: MCX JACK STRAIGHT CRIMP, RG178


USA: Sales: 800-490-2361


Technical Support: technicalsupport@pomonatest.com

Fax: 425-446-5844

Europe: 31-(0) 40 2675 150 **International**: 425-446-5500

Where to Buy: www.pomonaelectronics.com

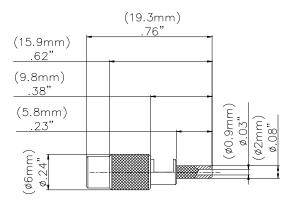

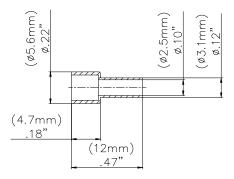

Specifications

| Impedance | 50 Ω |
|-----------------------------------|---------------------------------------|
| Frequency Range | DC - 3 GHz |
| VSWR | 1.4 max. |
| Working Voltage | 170 Vrms max. |
| Dielectric withstand voltage | 750 Vrms |
| Center / Outer contact resistance | 5 / 2.5 mΩ |
| Number of insertions | 500 cycles min. |
| Insulation resistance | 1,000 MΩ min. |
| Temperature Range | -55° C to 155° C, -67° F to 311° F |

All dimensions are in inches. Tolerances (except noted): $.xx = \pm .02$ " (.51 mm), $.xxx = \pm .005$ " (.127 mm). All specifications are to the latest revisions. Specifications are subject to change without notice. Registered trademarks are the property of their respective companies.

D2003448 REV 001




Model 73011 MCX JACK STRAIGHT CRIMP, RG178

Cable Types and Crimp Die Information


| | Connector Model # | Cable Groups | Crimp Die Cavity Size for Outer Ferrule |
|---|----------------------|--------------|---|
| Ī | 73011 | RG178 | .105 (2.67) |

Cable Assembly Instructions


1. CUT CABLE END EVENLY AND PERPENDICULAR




2. SLIDE OUTER FERRULE OVER CABLE END.



3. STRIP CABLE JACKET, BRAID, AND DIELECTRIC TO SPECIFICATION LENGTHS.

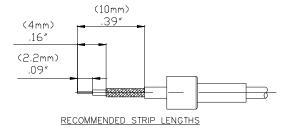


4. FLARE BRAID END SLIGHTLY.



5. SLIDE CONNECTOR BODY OVER CENTER CONDUCTOR.



6. SLIDE OUTER FERRULE OVER BRAID AND UP AGAINST BODY ASSEMBLY.



7. CRIMP OUTER FERRULE WITH APPROPRIATE CRIMP TOOL.



USA: Sales: 800-490-2361

 $\label{thm:component} \textbf{Technical Support} \\ \underbrace{\textbf{technical support@pomonatest.com}}_{} \\$

Fax: 425-446-5844

Europe: 31-(0) 40 2675 150 **International**: 425-446-5500

Where to Buy: www.pomonaelectronics.com

All dimensions are in inches. Tolerances (except noted): $.xx = \pm .02$ " (.51 mm), $.xxx = \pm .005$ " (.127 mm). All specifications are to the latest revisions. Specifications are subject to change without notice. Registered trademarks are the property of their respective companies.

D2003448 REV 001